

107

## **Engineer's Precision Squares**

Useful for setting up & checking jobs where extreme accuracy is required

Hardened spring steel blade are permanently fixed to the stock by means of tapered self locking rivets which ensure complete rigidity Both the blade and the stock are precisely ground to ensure parallelism & straightness


A groove on the inner corner of the stock aids in the clearance of burr or dirt



SS-A

## **ORDERING INFORMATION**

| CAT<br>NR. | BLADE<br>LENGTH (L1) | STOCK<br>LENGTH (L2) | SQUARENESS | BOX<br>QTY. |
|------------|----------------------|----------------------|------------|-------------|
|            | (MM)                 | (MM)                 | (MICRONS)  |             |
| SS/A/3     | 75                   | 60                   | 16         | 5           |
| SS/A/4     | 100                  | 75                   | 16         | 5           |
| SS/A/6     | 150                  | 100                  | 16         | 5           |
| SS/A/8     | 200                  | 125                  | 20         | 5           |
| SS/A/10    | 250                  | 165                  | 24         | 5           |
| SS/A/12    | 300                  | 210                  | 24         | 2           |

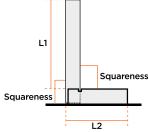

108

## Machinist's Squares

Every day workshop use general purpose steel squares


Made from selected steel with hardened blades, these squares have accurate right angled both on the inside & outside

Both blade and stock are accurately ground which ensures straightness and parallelism

Ideal for everyday use in workshops and wood industry application

L1

Squareness

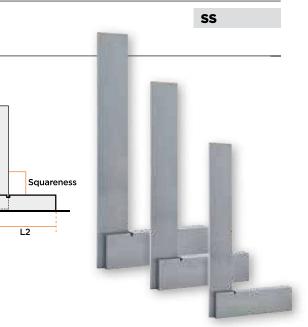

## **ORDERING INFORMATION**

| CAT.<br>NR. | BLADE<br>LENGTH (L1)<br>(MM) | STOCK<br>LENGTH (L2)<br>(MM) | SQUARENESS<br>(MICRONS) | BOX<br>QTY. |
|-------------|------------------------------|------------------------------|-------------------------|-------------|
|             |                              |                              |                         |             |
| SS/3        | 75                           | 60                           | 48                      | 10          |
| SS/4        | 100                          | 75                           | 48                      | 10          |
| SS/6        | 150                          | 100                          | 72                      | 10          |
| SS/8        | 200                          | 125                          | 72                      | 5           |
| SS/10       | 250                          | 165                          | 72                      | 5           |
| SS/12       | 300                          | 210                          | 96                      | 2           |
| SS/18       | 450                          | 255                          | 144                     | 1           |



